



**NUMBER:** 22-005-01

**GROUP:** Wheels/Tires

**DATE:** Jul. 13, 2001

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.*

**SUBJECT:**

Wheel Cover Rattle - 15" Steel Wheels

**OVERVIEW:**

This bulletin involves the addition of 5 foam pads to each wheel cover.

**MODELS:**

2000 - 2001 (PL) Neon

**NOTE: THIS BULLETIN APPLIES TO VEHICLES EQUIPPED WITH 15" STEEL WHEELS (SALES CODE W5J) BUILT BEFORE MARCH 13, 2001 (MDH 0313XX).**

**SYMPTOM/CONDITION:**

Rattle noise coming from the wheel cover over bumps.

**DIAGNOSIS:**

Drive the vehicle over a bump and listen for the rattle noise. If the rattle is heard, remove the wheel covers and verify the noise is gone. If the noise is gone with the wheel covers removed, perform the Repair Procedure.


**PARTS REQUIRED:**

Qty.	Part No.	Description
1	04897150AA	Mopar Brake Parts Cleaner
1	05083127AA	Foam Pads (Contains 20 Pads)

**REPAIR PROCEDURE:**

**THIS REPAIR IS COMPATIBLE WITH DAIMLERCHRYSLER'S MOBILE SERVICE PROGRAM AND DOES NOT REQUIRE HOISTS OR OTHER FULL SERVICE FACILITY SPECIAL EQUIPMENT.**

1. Clean the inside surface of the wheel cover where the foam pad will be installed using the Mopar Brake Parts Cleaner.
2. Wipe the cleaner off and allow the wheel cover to dry thoroughly.
3. Remove the backing paper from a foam pad and apply to in the center of one wheel spoke. Repeat the process until all five foam pads have been installed. (Fig. 1)
4. Repeat the procedure for the remaining three wheel covers.
5. Install the four wheel covers onto the vehicle and torque nuts to 25 in.lbs.

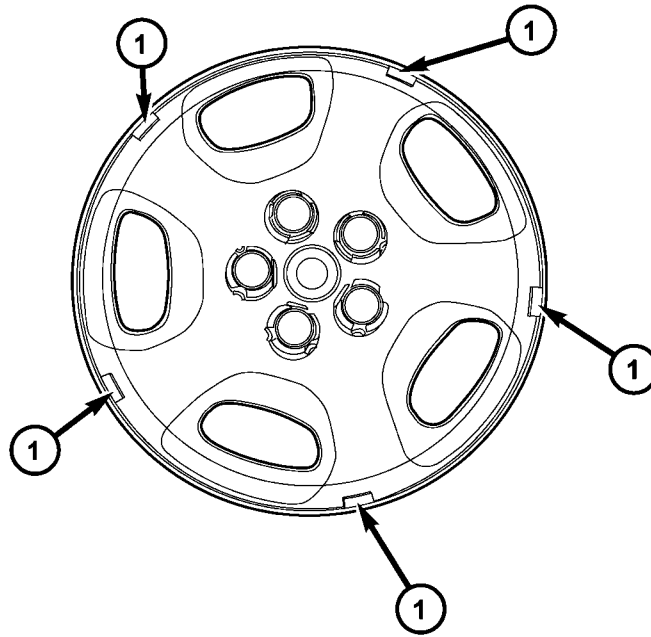

80dbf179

**Fig. 1 WHEEL COVER**

1 - FOAM PADS

---

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Amount
22-20-01-92	Foam Pads Wheel Covers (4) Install	0.3 Hrs.

**FAILURE CODE:**

P8	New Part
----	----------