



NUMBER: 21-001-02

GROUP: Transmission

DATE: Jul. 1, 2002

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

THIS BULLETIN SUPERSEDES SERVICE ACTION #02-007, DATED JUNE 18, 2002, WHICH SHOULD BE REMOVED FROM YOUR FILES.

SUBJECT:

Transaxle Slips In Reverse Or First Gear

OVERVIEW:

This bulletin involves replacing the low/reverse accumulator cover and O-ring during transmission repair.

MODELS:

2002	(JR)	Sebring Sedan/Sebring Convertible/Stratus Sedan
2002	(PL)	Neon
2002	(PT)	PT Cruiser
2002	(RS)	Town & Country/Voyager/Caravan

NOTE: THIS BULLETIN APPLIES TO VEHICLES EQUIPPED WITH AN AUTOMATIC TRANSAXLE WITH BUILD CODE DATES OF 1342 (MAY 14, 2002) THROUGH AND INCLUDING 1502 (MAY 30, 2002). REFER TO THE APPROPRIATE SERVICE MANUAL OR MDS2 SERVICE INFORMATION FOR THE TRANSAXLE LABEL LOCATION AND CODE INFORMATION.

SYMPTOM/CONDITION:

Some vehicles may have a transaxle that will not move or slips in Reverse or First gear.

DISCUSSION:

Vehicles equipped with automatic transaxles built in the range specified that exhibit the condition(s) listed above may also have Diagnostic Trouble Code(s) (DTC) P0736, Gear Ratio Error In Reverse, or P0731, Gear Ratio Error In 1st set. All vehicles that fall in this category **must** have the **Low/Reverse Accumulator Cover and O-Ring** replaced during transmission repair.

PARTS REQUIRED:

Qty.	Part No.	Description
1	04431617	Cover, Low/Reverse Accumulator
1	06501549	O-Ring, Low/Reverse Accumulator

POLICY:
Information Only