

International Technical Service Bulletin

NUMBER: I26-807-03

GROUP: Revisions

DATE: Aug. 1, 2003

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

SUBJECT:

Owner Manual Addendum - Headlamp Bulb Replacement

MODELS:

2004 (PL) Neon

DISCUSSION:

Owner's Manual Addendum for headlamp bulb replacement is available for 2004 PL vehicles. This addendum can be found and printed from ITIL CD 052 or later. Locate the SB by document number I26-807-03.

All unsold vehicles in dealer/distributor inventory should have the addendum placed in the Owner's Manual.

POLICY:

Information Only.


OWNER'S MANUAL ADDENDUM

THIS ADDENDUM UPDATES THE INFORMATION IN THE BULB REPLACEMENT PORTION OF YOUR OWNER'S MANUAL.

BULB REPLACEMENT

Headlamp Bulb Replacement


1. Remove two screws from the headlamp module and pull module from the vehicle.

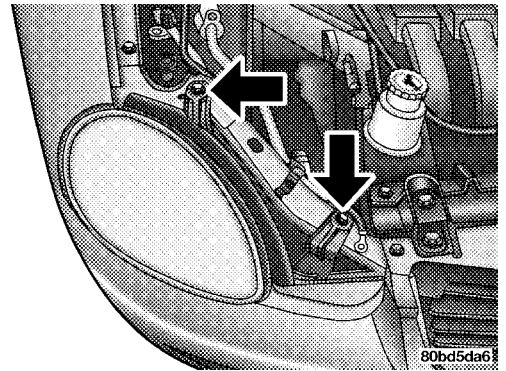

NOTE: The headlamp module is located to the fender by a molded pin. Pull the outboard side of the headlamp straight out until the molded pin clears the fender, then slide the headlamp out from behind the bumper fascia and grille.


2. Disconnect electrical connector and remove the rubber boot seal.

3. Remove retaining ring and replace bulb.

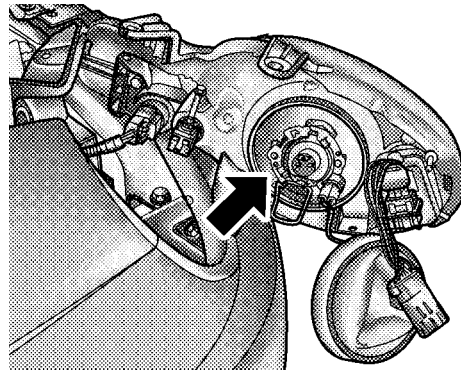

CAUTION!

During installation, be sure when tightening the inboard screw, to only tighten until the rubber grommet on the screw starts to compress against the headlamp module housing.

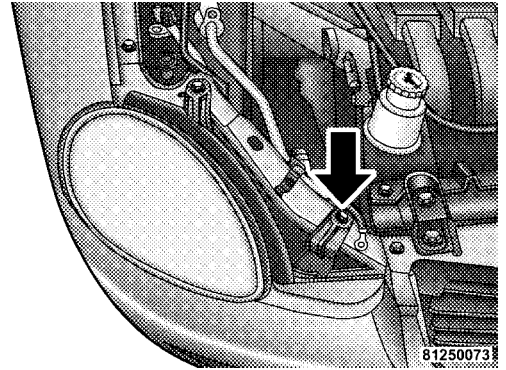

DaimlerChrysler Corporation

81-426-04096A
81-426-04098A
81-426-04083A
81-426-04084A
81-426-04964A
81-426-04090A